



One of the patches required in the boiler of Ab 608 – This outer shell section includes the mountings for the safety valves.



Boiler prepared to receive patch.



Patch plate rolled and ready to be lifted into position for fitting.



Alastair Maciver checks the Ab blueprints during preparation of the patch repair.



Bob Hall fits electrical conduit to the cab of Ab 608. A tender bogie frame lies alongside under repair.



In the Steam Incorporated workshop, the near completed cab shares space with the tender body, still in two halves, about to be joined together. Tender wheelsets are gathered in the foreground.



Peter Norman and Linn Alexander drill holes in one of the doubling plates for the tender body before Huck-bolting them in position. In this view, the front, bunker section of the tender body is upside down.



Ab 608's boiler mounted on roller-equipped accommodation bogies in preparation for major boiler repairs.